

Annual Inspection

Barby & Onley Parish Council

Onley Play Area

89 Onley Park, Onley, Wiloughby, CV23 8AN















Wicksteed Leisure Limited, Digby Street, Kettering, Northamptonshire, NN16 8YJ

www.wicksteed.co.uk

01536 517028 customerservices@wicksteed.co.uk





Inspection Scope for RPII Inspection Methodology

This document outlines the RPII scope for inspections undertaken by the Inspectors listed as Annual Inspectors on the RPII Register of Inspectors when undertaking Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine inspections.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it will be the standard that is current at the time of inspection except where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection, unless they are also explicitly listed here.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this includes public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below):

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 – Part 7) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standards (BS EN 71 series – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance will follow the requirements and recommendations of BS EN 1176.

When water play items, including spray parks, are inspected any comments concerning compliance within the inspection will refer to BS EN 176. We have not assessed these against the requirements of BS EN 17232 (Water play equipment and features).

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with these current standards, and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area (that area which is obviously part of the playground), nominally up to three metres around, the fence line if closer, or other areas as agreed.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity, wear and vandalism.

Routine visual inspections relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

All inspections are non-dismantling, non-destructive and do not include any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all reasonably accessible equipment and will assess all reasonably accessible parts above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment.

Ancillary equipment will be assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to a general safety assessment).

The owner/operator is responsible for the overall safety of the equipment and area.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of the impact attenuating properties of any surfaces; the identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection; the inspection of any equipment (or part thereof) that is beneath the playing surface (loose-fill materials may be moved to expose foundations); tightening any bolts, hinges or other fixing devices on any apparatus or equipment; assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment; assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming); where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken – the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity. This inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/or that of the inspection company. The owner/operator should always seek the advice of the manufacturer or a competent person when undertaking repairs and/or modifications to equipment.

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	✓	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	~	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	×
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Inspection of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	×

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

- [1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.
- [2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.
- [3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.
- [4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.
- [5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity						
			Severity>>						
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)	
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)	
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)	
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)	
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)	
				Very Low	Low	Moderate	High	Very High	
	- SINCE 1918 -			1	2	3	4	5	
				No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
				Severity>>					

Note 1: The total risk scores included within our reports are a multipication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).

Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.





Onley Play Area

Inspection Ref: 2522617 Site Ref: 90999
Property Ref:1267033-425810 Service Object Ref:

Inspected: 29-October-2024 - 07:57 by Michael Allbright

Risk Assessment: 12 Moderate Risk



Location:

The site is located in an area of public open space and is overlooked by a number of properties in the local community. **Disabled Access:**

Generally accessible; an area accessible to most.







10 - Low Risk

Item:1 Bay 1 Seat (Cradle) - Type 1Manufacturer:Playdale Playgrounds Ltd

Surface Type: Grass Matrix Tiles

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 3



Finding 1

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

Finding 3

There is some notable evidence of chain wear - Monitor for any further deterioration and replace when 40% worn

Finding 2

There is some evidence of rot in the timber. The swing frame is in generally poor condition - Monitor for any further deterioration and replace as required. Recommend replacing the swing frame in the longer term





Æ

12 - Moderate Risk

Item:Multi Play (Junior)Manufacturer:Playdale Playgrounds Ltd

Surface Type: Grass Matrix Tiles

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 5



Finding 1

The rope net has worn and wire strands are exposed -

Replace rope net

Finding 2

The access net ground log forms a hard object within the falling space of the equipment in contravention of the requirements of BS EN 1176 Part 1 - Monitor - Refer to manufacturer

Finding 3

There are gaps opening between the grass mat tiles - Reinstate surface

Finding 5

The slide is predominately south facing and will catch the majority of the sun's heat during the day. Slide surfaces can become very warm during periods of sustained sunny weather - Monitor - No remedial work recommended

Finding 4

Wear on the edges of the ramp panel and treads - Monitor and replace as required

12 - №

12 - Moderate Risk

Item: Climbing Frame

Manufacturer: Wicksteed Playgrounds
Surface Type: Grass Matrix Tiles

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

There is a fixing missing corroded on the item - Replace all missing fixings







6 - Low Risk

Item: 1 Bay 2 Seat (Flat)

Manufacturer: Unknown

Surface Type: Grass Matrix Tiles

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 2



Finding 1

There are gaps opening between the grass mat tiles -

Reinstate surface

Finding 2

The paint is flaking off the metalwork corrosion present -

Rub down and re-paint



4 - Very Low Risk

Item:Rotating NetManufacturer:Tayplay LtdSurface Type:Grass Matrix Tiles

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -







2 - Very Low Risk

Item:SeatManufacturer:UnknownSurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



4 - Very Low Risk

Item:Spring HorseManufacturer:AusplaySurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -







4 - Very Low Risk

Item:Misc SpringerManufacturer:AusplaySurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



6 - Low Risk

Item:Spring DuckManufacturer:AusplaySurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

The end of the footrests have a cross section of less than 15cm2 and fail to meet the requirements of BS EN 1176 Part 6 - Monitor - Refer to manufacturer





Æ

12 - Moderate Risk

Item: Fencing - Timber

Manufacturer:UnknownSurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

There are areas or parts of the timber on the structure that have rotted - Replace all affected timbers

9

5 - Very Low Risk

Item:GateManufacturer:UnknownSurface Type:Mixed Surface

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

The gate is snagging on the surrounding surface preventing it from closing correctly - Carry out remedial works to ensure the gate closes correctly





🎧 5 - Very Low Risk

Playground Sign Item:

Manufacturer: Unknown **Surface Type:** N/A **Item Quantity:** 1 **Equipment Compliance:** N/A Surface Area Compliance: N/A

Total Findings: 1



Finding 1

The emergency contact number should be 999 or 112 - Change the number on the sign



Findings information



Finding: The timber has a number of splits/shakes or air Action: Monitor to ensure the splits do not cross through cracks and this may affect the stability or allow water ingress fixing points of the structure and/or cause any instability which will accelerate the rotting process





Item:Swings - 1 Bay 1 Seat (Cradle) - Type 1Risk Level:L - Low RiskManufacturer:Playdale Playgrounds LtdSurface:Grass Matrix Tiles







Finding: There is some evidence of rot in the timber. The swing frame is in generally poor condition

Action: Monitor for any further deterioration and replace as required. Recommend replacing the swing frame in the longer term







Item:Swings - 1 Bay 1 Seat (Cradle) - Type 1Risk Level:L - Low RiskManufacturer:Playdale Playgrounds LtdSurface:Grass Matrix Tiles







Finding: There is some notable evidence of chain wear

Action: Monitor for any further deterioration and replace when 40% worn







Item:Activity Equipment - Multi Play (Junior)Risk Level:M - Moderate RiskManufacturer:Playdale Playgrounds LtdSurface:Grass Matrix Tiles







Finding: The rope net has worn and wire strands are exposed

Action: Replace rope net





Item:Activity Equipment - Multi Play (Junior)Risk Level:V - Very Low RiskManufacturer:Playdale Playgrounds LtdSurface:Grass Matrix Tiles








Finding: The access net ground log forms a hard object within the falling space of the equipment in contravention of the requirements of BS EN 1176 Part 1

Action: Monitor - Refer to manufacturer







Item:Activity Equipment - Multi Play (Junior)Risk Level:L - Low RiskManufacturer:Playdale Playgrounds LtdSurface:Grass Matrix Tiles





Finding: There are gaps opening between the grass mat tiles

Action: Reinstate surface





Item:Activity Equipment - Multi Play (Junior)Risk Level:L - Low RiskManufacturer:Playdale Playgrounds LtdSurface:Grass Matrix Tiles







Finding: Wear on the edges of the ramp panel and treads

Action: Monitor and replace as required





6 - Low Risk (Finding 5)

Item:Activity Equipment - Multi Play (Junior)Risk Level:L - Low RiskManufacturer:Playdale Playgrounds LtdSurface:Grass Matrix Tiles






Finding: The slide is predominately south facing and will catch the majority of the sun's heat during the day. Slide surfaces can become very warm during periods of sustained sunny weather

Action: Monitor - No remedial work recommended



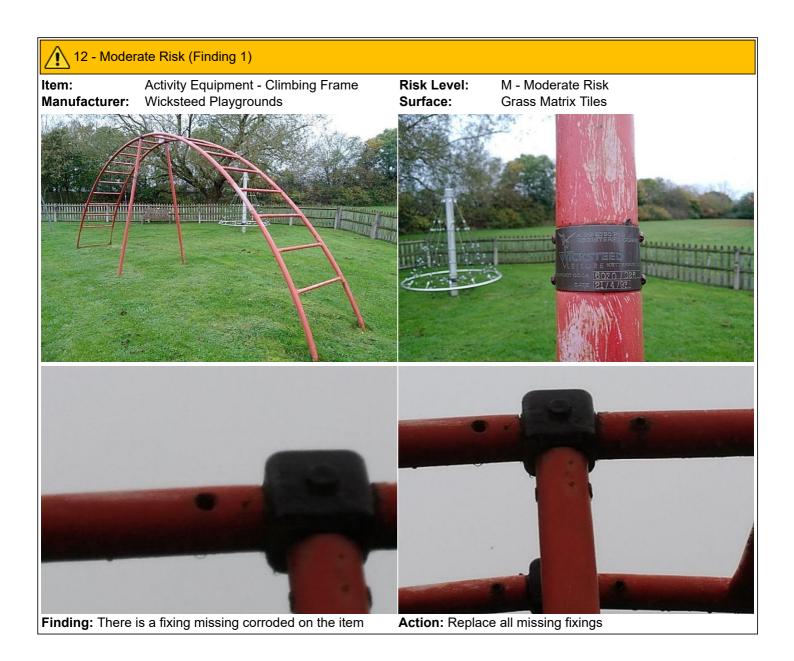












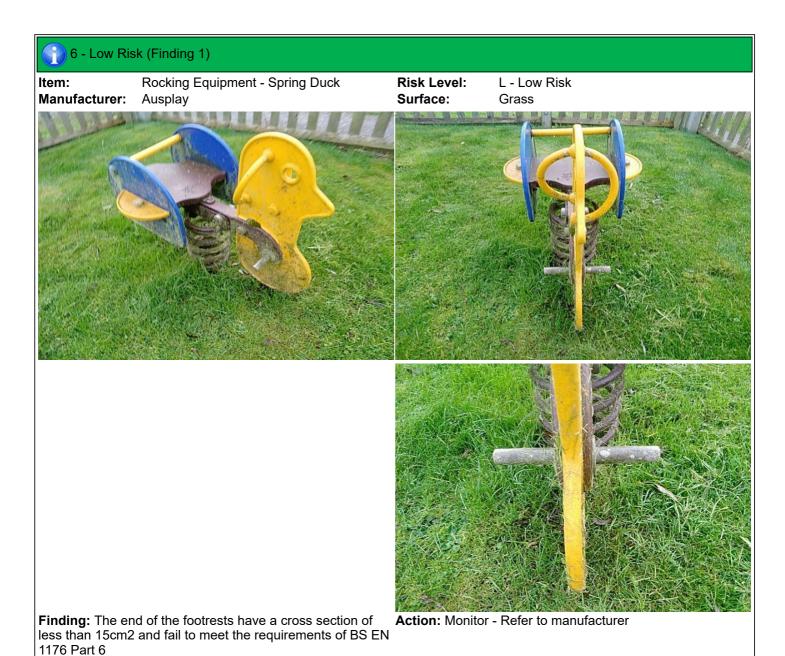







Item: Fences - Fencing - Timber

Manufacturer: Unknown











Finding: There are areas or parts of the timber on the structure that have rotted

Action: Replace all affected timbers







